AC ACTIVE POWER 2-STEP OVERLOAD GUARD



 Precision 2-Step Overload Protection, not affected by heavily distorted waveforms

KPW19x

- Total processing time less than 50mS
- 3 or 4-wire systems. Definite time trip delays
- Triple relay operation gives more flexibility
- Optional fast analogue kW-signal output, <50mS
- Wide range setting of high overload contact hysteresis

Specifications

Monitored Voltage:	100-120V, 200-240V, 380-415V, 440-460 or 480VAC
	40-70Hz (Fuse 0,5A)
Optional Separate	100-120V, 200-240V,
Auxiliary Voltage AC:	380-415V, 440-460 or 480VAC
	40-70Hz (Fuse 0,5A)
Optional Separate	24, 48 or 110VDC (Fuse 2A)
Auxiliary Voltage DC:	(Add nr 2 for models with separate aux. supply. ex: KPW191E2)
Supply tolerance:	± 10%
Power rating:	1,5VA
Current Input:	1 or 5A C.T. <0,1VA
Contact rating:	AC: 100VA - 250V/2A max.
	DC: 50W - 100V/1A max.
Adjustments available:	See under Relay Operation (page 2)
Analogue outputs:	Up to 20mA, max 500ohm
	Up to 10VDC, min 100kohm
	(other outputs available on request)
Temperature:	-20 to +70°C
Weight:	0.64kgs
Front protection:	IP52 (IP65 optional)

The unit meets EN 61010-1 Cat. III, Pollution degree 2 and the relevant environmental and EMC tests specified in EN 61326-2-4 to comply with the requirements of the major Classification Societies.

Application

The digitally controlled KPW19x range provides precision (1.0%) 2-step overload protection and monitoring of three phase generators or motors.

Available for 3-phase 3-wire (2W3) and 4-wire (3W4) systems.

The unit measures the voltage and current true r.m.s. value, and accuracy is independent of any wave form distortion.

As standard the auxiliary voltage is taken from the unit monitored voltage input. A separate AC or DC auxiliary voltage is optionally available.

A green LED indicates POWER on. Start of monitoring function is delayed when power is switched on (default 2 secs delay). In this way false tripping during power up is avoided.

The DIN96 instrument reads the power level directly in kW. The wattmeter and the triple-zone status LEDs at a glance gives the clear safety message:

- LEVEL 2 - LEVEL 1 - NORMAL
-

www.megacon.com

L AND INSTRUMENTATION

ECTRONIC CONTRO

OUTPUTS

If output is used for remote meter reading, we recommend 0-1mA for the slave indicator.

Related information:


The KPW19x-range is also available for rail mounting as KCW19x.

Norway Denmark United Kingdom



REF: Datasheet.KPW19x - REV: 2.01/04.2019 © All rights reserved to Megacon legacon reserves the right to make any changes to the information at any time

AC ACTIVE POWER 2-STEP OVERLOAD GUARD

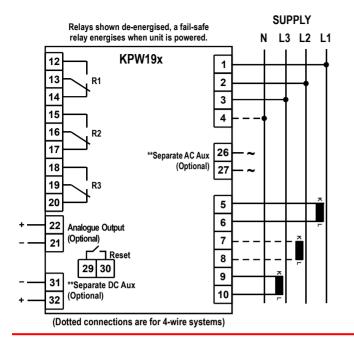

Description

KPW191E - KPW191F

Both overload relays can be used for non-essential load release or as an alarm indication. A wide range overload contact hysteresis can be set to enable R2 to be used for a non-essential load to be reconnected or as a standby generator stop signal. Relay R3 is an additional relay that can be used for local indication, as an input to an alarm system etc.

A trip LED flashes when the trip level is passed, the relay trips when the delay has elapsed. The timer resets if the fault is removed during countdown.

KPW194E - KPW194F

Both overload relays can be used for non-essential load release or as an alarm indication. A wide range overload contact hysteresis can be set to enable R2 to be used for a non-essential load to be reconnected or as a standby generator stop signal. Relay R3 is an additional relay that can be used for local indication, as an input to an alarm system etc.

A trip LED flashes when the trip level is passed, the relay trips when the delay has elapsed. The timer resets if the fault is removed during countdown.

Analogue Output

KPW191F and KPW194F have an analogue output proportional to kW-meter reading. The signal is specifically intended as input to a control system for kW monitoring, load sharing, load shedding etc.

Add to type designation suffix from table below to designate output required:

0/P1 0/P2	0 - 10mA 0 - 20mA	O/P6 O/P7	N/A N/A
O/P3	4 - 20mA	O/P8	0-10V
O/P4	N/A	O/P9	0,2-10V
O/P5	N/A	O/P10	4,3-20mA

To ensure correct kW measurement voltage phase sequence and CT, connections MUST be as shown on connection diagram.

**Optional separate aux. supply:

Add nr 2 for models with separate aux. supply. (Exemple: KPW191E2)

Relay Operation

Configuration: 3-Phase, 3-Wire (2W3)

	OVERLOAD LEVEL 1	OVERLOAD LEVEL 2	N/A	Fail Safe	Latch	Fixed Hysteresis	Adjustable Hysteresis
R1	\checkmark					\checkmark	
R2		\checkmark		\checkmark			\checkmark
R3		\checkmark					


Output Mode Latch KPW191E KPW191F

х


Adjustments Delay Trip level 0-100% of FSD Overload level 2: 0-30secs Overload level 1: Hysteresis O/L 2: 0-100% of O/L 2 2-50% of FSD 0-30secs Hysteresis O/L 1: Fixed 2% of FSD

KPW19x


Configuration: 3-Phase, 4-Wire (3W4)



Model KPW194E Latch Output KPW194F х



Relay Configurations

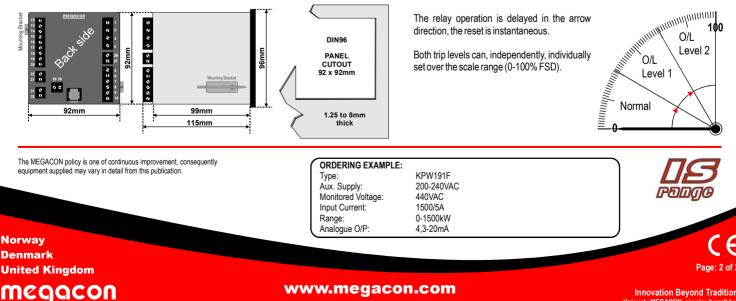

ELECTRONIC CONTRO L AND INSTRUMENTATION Innovation Beyond Tradition MEGACON

Dimensions